

## Public Announcement regarding 2017-2022 Ford Super Duty XB LED Tails (LF350 & LF351)

**SKU:** LF350 & LF351


**Issue:** Morimoto taillight harness does not connect to OEM truck connector, specifically trucks with OEM LED tail lights.  
(NOTE: this issue does not effect OEM Incandescent taillight trucks)

**Description:** The connector on Morimoto's 2017-2022 Ford Super Duty XB taillight connector should only include one alignment tab. Some sets were shipped with two alignment tab connectors. Sets with two alignment tabs will not connect to the OEM connector on trucks with OEM LED taillights.

Connectors should look like this:



If your connector looks like this AND you have an OEM LED taillight, then you will need to perform the remedy described below:

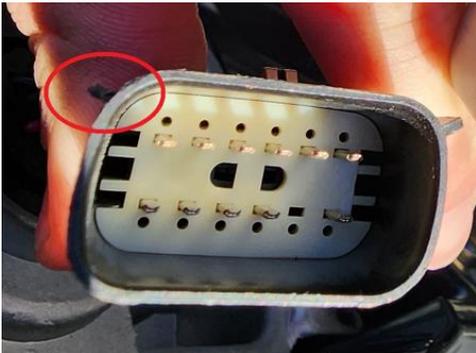

**Remedy:** Customer can fix the issue by carefully trimming the tab with a razor blade (away from their body) or similar sharp tool. Please use all proper precautions when working with sharp tools.



Questions? Please give us a call at 424-239-5142 or email us at [service@morimotohid.com](mailto:service@morimotohid.com)